Catalog Id		Conductor			Stud Size	Dimensions									Color Code	Installation Tooling					Dieless
Without Inspection Window (Fig-1)	With Inspection Window (Fig-2)	AWG	Flex Conductor G,H,I,K,M & DLO	Expanded Cod. Range		OD	L	B	A	W	T	∅F	E	C		Burndy Model - Y35, Y39, Y750, PAT750, PAT750LI	IIsco ILC-12-N, ILC-12-H-N, ILCB-12		Huskie Model - EP-510C Die Index	Greeniee HK1240	
98094	P98094	#1/0	#1	#1/0 - #6	5/16	0.52 [13.20]	3.01 [76.50]	1.20 [30.50]	1.61 [41.00]	0.74 [18.90]	0.13 [3.20]	0.33 [8.40]	0.32 [8.10]	0.87 [22.20]	Pink	U25RT U2CART	ILD-8	ILD - 42	HT41AY	KC12-1/0	Burndy Dieless - PAT444S & PAT4PC834LI. IIsco Dieless -IDT-6, IDT-6H, IDTB-6, IDTB-6-LIO, TB-6DF1000-P,IDT-12-N, IVTB-6. Greenlee & NSI Dieless - HK12ID, EK12IDL, N12ID.
98095	P98095				3/8	0.52 [13.20]	3.20 [81.50]	1.20 [30.50]	1.81 [46.00]	0.74 [18.90]	0.13 [3.20]	0.41 [10.50]	0.38 [9.70]	1.00 [25.40]							
98095A	P98095A				1/4	0.52 [13.20]	2.65 [67.50]	1.20 [30.50]	1.26 [32.00]	0.74 [18.90]	0.13 [3.20]	0.25 [6.40]	0.28 [7.10]	0.62 [15.90]							
98095B	P98095B				3/8	0.52 [13.20]	3.01 [76.50]	1.20 [30.50]	1.61 [41.00]	0.74 [18.90]	0.13 [3.20]	0.41 [10.50]	0.32 [8.10]	0.75 [19.10]							
98095C	P98095C				3/8	0.52 [13.20]	4.39 [111.50]	1.20 [30.50]	2.99 [76.00]	0.74 [18.90]	0.13 [3.20]	0.41 [10.50]	0.62 [15.70]	1.75 [44.50]							
98096	P98096				1/2	0.52 [13.20]	4.39 [111.50]	1.20 [30.50]	2.99 [76.00]	0.74 [18.90]	0.13 [3.20]	0.51 [13.00]	0.62 [15.70]	1.75 [44.50]							

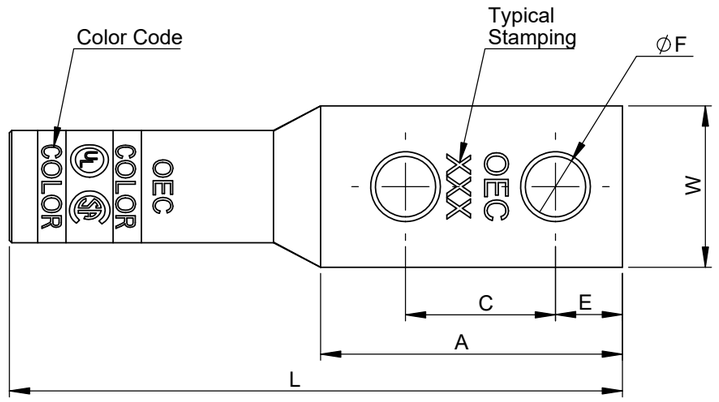

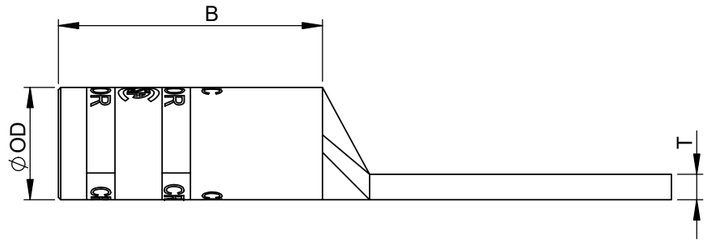

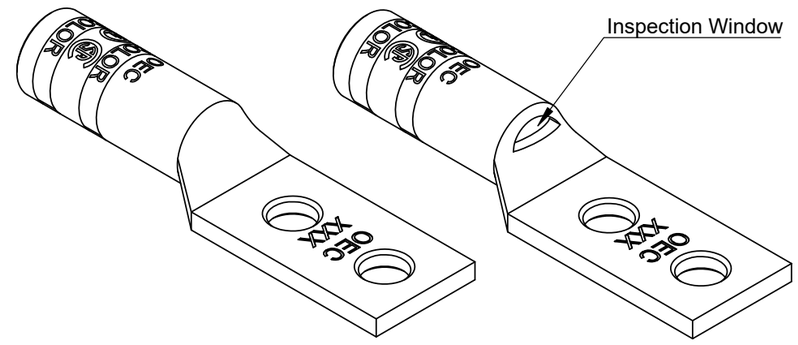

Fig-1

Fig-2

Note:
- Manufactured from high strength seamless Copper tubing
- Color coded die index and crimp marks
- Electro-Tin plated for corrosion resistance
- Pre-filled with oxide inhibitor and capped with color coded cap.
- UL486A/B Listed for Wire Connectors
- UL Listed and CSA Certified with competitor's compression tools
- Listed for use with class B & C, flex class G, H, I, K, M & DLO cable

Crimping Instructions

- Select the proper lug or splice connector for the size of cable being installed, ensuring that the size matches the description in the table.
- Strip the insulation from the cable to a length so that the stripped area of the cable can be completely inserted into and fill the barrel of the lug or splice. Carefully strip the insulation from the cable without nicking the strands.
- Clean the stripped portion of the cable to remove oxide films.
- The stripped portion of the cable must be clean and inserted completely into the connector barrel.
- Using the tool and die combination specified for that connector in the table above, install crimps, leaving a space of 1/8 inch minimum between successive crimps.
  For Short Barrel Connectors, apply 1 crimp,
  For Long Barrel Connectors, apply 2 crimps on the color coded bands

THE INFORMATION CONTAINED WITHIN THIS DOCUMENT IS PROPRIETARY TO OEC AND MAY NOT BE DISCLOSED WITHOUT PRIOR WRITTEN CONSENT

TOLERANCE					
OD	L	B	A	W	∅F
±0.20	±1.0	±0.50	±0.50	±1.0	±0.20

TOLERANCES-UNLESS OTHERWISE SPECIFIED		NAME	DATE
2 PL. DEC. ±.015 TRUE C.L. ±.015	DRAWN	R.P	20.02.25
3 PL. DEC. ±.015 ANGLES ±.015	CHECK	S.P.	20.02.25
	APPROVED	M.K.	20.02.25

OEC Usa Inc.
106 Northfield Avenue, Edison, NJ 08837,
Phone: +1 732-479-0469 www.oec-americas.com

DWG. NO. OC-0012

PROJECTION: FIRST ANGLE

SIZE A3

TITLE: Copper Two Hole Long Barrel Compression Lug

MATERIAL Refer Note

FINISH Refer Note

Cat Id. 98094 - 98096 REV

DO NOT SCALE DRAWING SHEET 7 OF 19